Technical Bulletin

Model(s)
32WL66P, 37WL66P, 42WL66P, 32WLG66, 32WLT66, 37WLG66, 37WLT66, 42WLG66, 42WLT66
Symptom
Subject: LVDS lead wire dressing
Cause
LVDS lead wire with a conductive tape should be dressed to the chassis GND with lead wire clamper after servicing to meet EMC requirement.
Refer to the picture for actual wiring dressing.
Note: The picture for the lead wire dressing shows some of representative model only. Follow the actual model original lead wire dressing.
Cure:

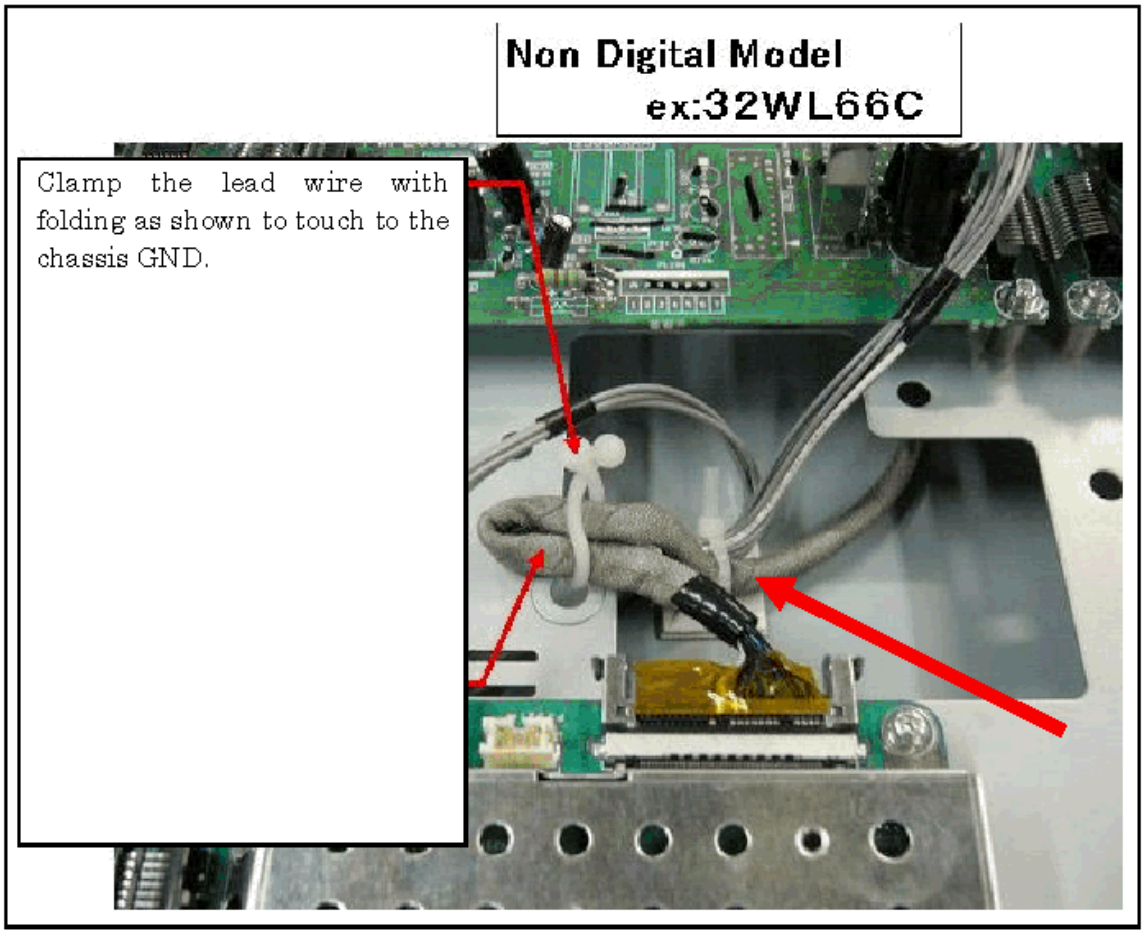

42WL66C

Clamp the lead wire to touch to the chassis GND.

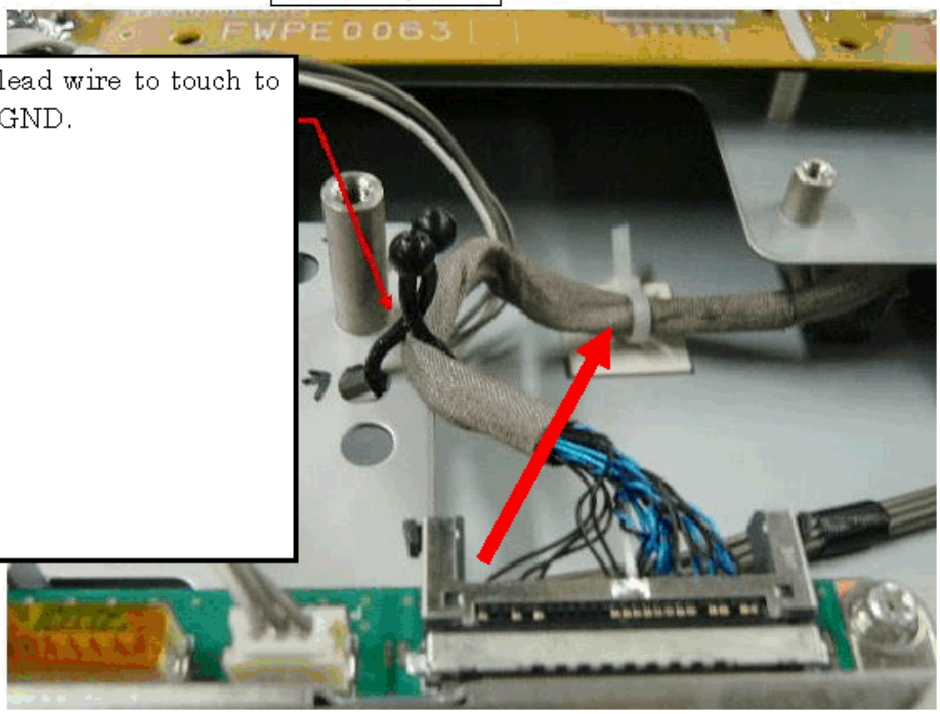

Digital Model
ex:32WLT66
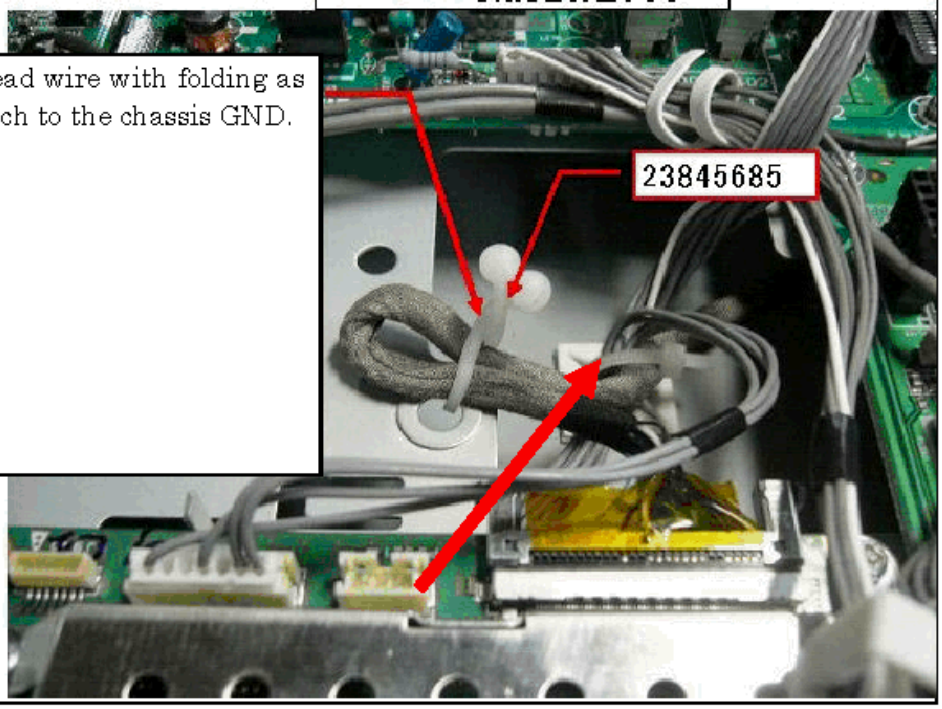
Clamp the lead wire with folding as shown to touch to the chassis GND.